

---

# Civil Punchlist

**Project Name:** Crestwood HS Athletic Fields      **Report By:** Will Rogan, PE  
**Project Location:** Sumter, SC      **Phone #:** 843-225-5151  
**Cypress Project #:** 22006      **Email:** WillR@CypressEng.com  
**Contract #:** N/A

---

**Visit Date:** February 24, 2025  
**Visit Time:** 2:30 – 4:00 PM  
**Parties Present:** Will Rogan – Cypress Engineering  
Dee Cook / Chris Catoe – Sumter School District

---









## Notes:









- This Punchlist serves as a Final Punchlist. Once Punchlist items are completed, Contractor needs to notify Cypress Engineering for confirmation.









## Observations:




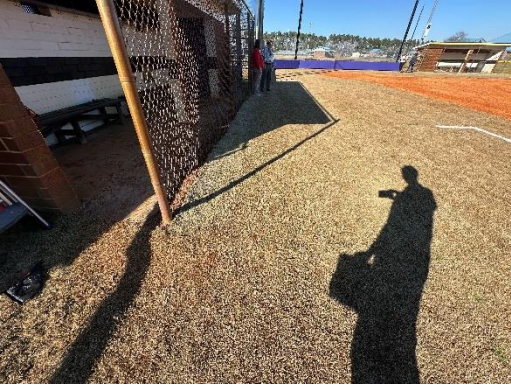




1. Contractor needs to fix rutting across various areas of site before applying permanent seeding. (P1.1, P1.2, P1.3, P1.4)
  2. Contractor needs to backfill to perimeter curbing around entire track to eliminate trip hazard then stabilize area between curbing and fencing. (P1.5, P1.6, P1.7, P1.8, P2.1, P2.2)
  3. Contractor needs to achieve 70% permanent stabilization across entire disturbed area. (P2.3, P2.4, P2.5, P2.6, P2.7, P2.8)
  4. Contractor needs to install 8' wide concrete sidewalk from asphalt drive to home bleachers per Site Plan. (P3.1)
  5. Contractor needs to remove excess fill material from site. (P3.2, P3.3)
  6. Contractor needs to repair erosion between home bleachers and catch basin and stabilize area. (P3.4)
  7. Contractor needs to adjust final grades and gate elevations to allow for proper operation and closing. (P3.5)
  8. Contractor needs to coordinate with Owner to provide ADA access onto track and field from home bleacher side. New bleachers block existing gates. (P3.6)
  9. Contractor needs to cut new PVC pipe CB EX B at south end of field to be flush with entry wall. Currently it extends into structure and will inhibit stormwater flow. (P3.7)
  10. Contractor needs to remove all sediment, rocks and debris from storm structures throughout site. (P3.8, P4.1)
  11. Contractor needs to install 6' wide sidewalk from asphalt drive to Visitors bleachers per Site Plan. (P4.2)
  12. Bleacher contractor installed Visitor's bleachers with gap and stairs. The bleachers should be adjacent to each other with no stairs. (P4.3)
-

13. Contractor needs to remove brick edge at fencing and install 24" wide warning track material from outer edge of each dugout. (P4.4, P4.5)
14. Contractor needs to confirm if piping in green box behind softball pitchers mound is operational. If not, it needs to be abandoned, box removed and backfilled to final grade. (P4.6)
15. Contractor needs to attach netting to gate post at either dugout to close gap that is foul ball safety hazard. (P4.7, P4.8)

P1.1			P1.2
P1.3			P1.4
P1.5			P1.6
P1.7			P1.8

P2.1			P2.2
P2.3			P2.4
P2.5			P2.6
P2.7			P2.8

P3.1			P3.2
P3.3			P3.4
P3.5			P3.6
P3.7			P3.8

P4.1			P4.2
P4.3			P4.4
P4.5			P4.6
P4.7			P4.8